

Obstructed Fuel Line Connector – Mariner/Mercury 8-200 Models

Fuel line connector P/N 22-13563A3 may have excess plastic in the fuel passageway inside the housing. Excess plastic may prevent full coupling of the fuel line to the outboard fuel connector and/or restrict fuel flow to the engine. Outboards and service stock listed require inspection of fuel line connector.

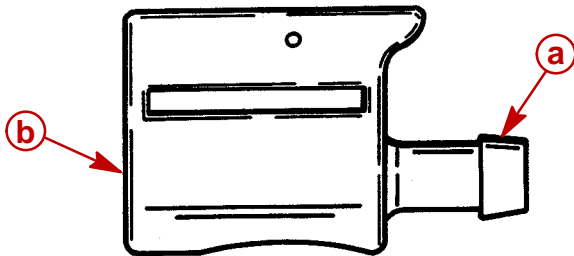


Figure 1. Fuel Line Connector P/N 22-13563A3 50943

- a - Fuel Line End
- b - Brass Piece in End

MODELS: US PRODUCTION ONLY

Mariner and Mercury models

8/9.9/15	S/N 0C262126-0C269698
20/25	S/N 0C263486-0C271032
40 (4 Cyl.)	S/N 0C264725-0C268339
40 MLH (4 Cyl.)	S/N 0C264725-0C268354
50/60	S/N 0C264725-0C268332
75-115	S/N 0C265590-0C275597
135-200	S/N 0C266282-0C273335

QUICKSILVER:

P/N 22-13563A3 Fuel Line Connector
Package date code 11/1/89 – 12/13/89

INSPECTION:

Inspect for excess plastic in passageway by looking into connector from fuel line barbed end. Brass piece on opposite end of connector should be fully visible. If brass piece is not visible, the connector is defective and must be replaced.

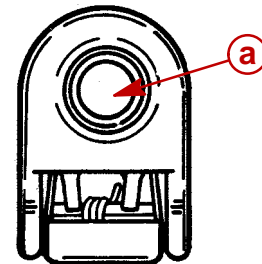


Figure 2. Non Obstructed Fuel Line Connector 50943

- a - Brass Piece is Fully Visible – Passageway Not Obstructed

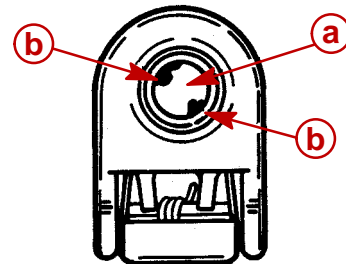


Figure 3. Obstructed Fuel Connector 50943

- a - Brass Piece Partially Visible
- b - Excess Plastic in Passageway

WARRANTY:

Complete warranty claim listing:

Outboard serial number

Qty. 1 P/N 22-13563A3 Fuel Line Connector

Two tenths (0.2) hour labor

Destroy defective connector